








Part Number: **EQHF-205140050-026**

Revision: 2023-Dec-06

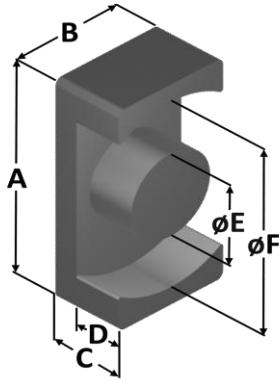

A	20.50 ± 0.30 mm	0.807 ± 0.012 in
B	14.00 ± 0.20 mm	0.551 ± 0.008 in
C	5.000 ± 0.203 mm	0.197 ± 0.008 in
D	2.300 mm (min.)	0.091 in (min.)
E	8.800 ± 0.20 mm	0.346 ± 0.008 in
F	17.80 mm (min.)	0.701 in (min.)
Mass	(approximate)	5.8 grams/half
Magnetic Dimensions	A_e - Eff. Mag. Cross Section 0.608 cm ² L_e - Eff. Mag. Path Length 3.28 cm V_e - Eff. Core Volume 1.99 cm ³ W_A - Min. Eff. Window Area 0.202 cm ² s_a - Surface Area 13.3 cm ² mlt - mean length per turn 4.18 cm	
Inductance	μ_i (reference) 26 A_L value (nominal) 60 nH/N ² Test Winding N=10, #26 AWG Frequency 10 kHz Voltage on Agilent 4284A 0.027 V A_L tolerance ±12%	
Core Loss	$\text{Core Loss (mW/cm}^3\text{)} = \frac{f}{\frac{a}{B_{pk}^3} + \frac{b}{B_{pk}^{2.3}} + \frac{c}{B_{pk}^{1.65}}} + d \cdot B_{pk}^2 \cdot f^2$ where B_{pk} expressed in gauss, f expressed in hertz, and: $a=1.000E+06$, $b=1.989E+08$, $c=3.057E+06$, $d=3.836E-14$ B_{pk} 300 G frequency 100 k Hz Core Loss (nominal) 189 mW/cm ³ Core Loss (maximum) 217 mW/cm ³	
DC Saturation	$\% \mu_i = \frac{1}{a + b \cdot H^c} + d$ where H expressed in oersteds, and: $a=1.000E-02$, $b=7.681E-07$, $c=1.548$, $d=0.000$ H_{oc} 200 Oe Percent Initial Perm.(nom.) 78.1 % Percent Initial Perm.(min.) 72.9 %	
Coating/Pkg	Coating Type: None Voltage Breakdown (min.) N/A Limit N/A Package Quantity 1,008 Halves/Box	

Winding Table	Wire Size	AWG	20	22	24	26	28	30	32	34	36	38	40
		mm	0.800	0.630	0.500	0.400	0.315	0.250	0.200	0.160	0.125	0.100	0.080
Full Winding	Turns		15	23	36	56	86	133	206	319	494	764	1,183
	Rdc(Ω)		20.9 m	50.9 m	126.6 m	313.2 m	764.9 m	1.9	4.6	11.4	28.1	69.1	170.2

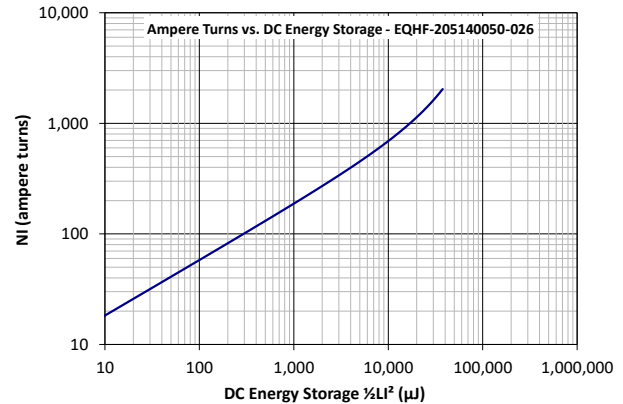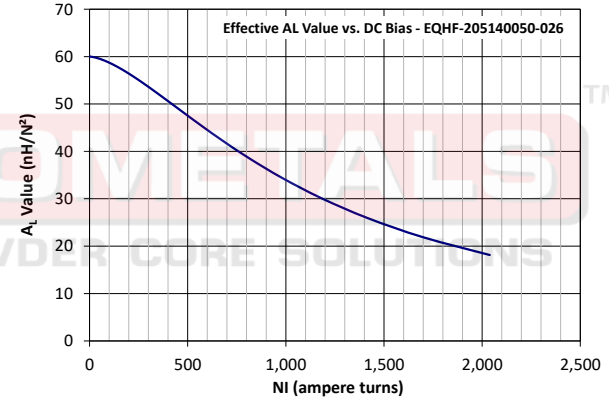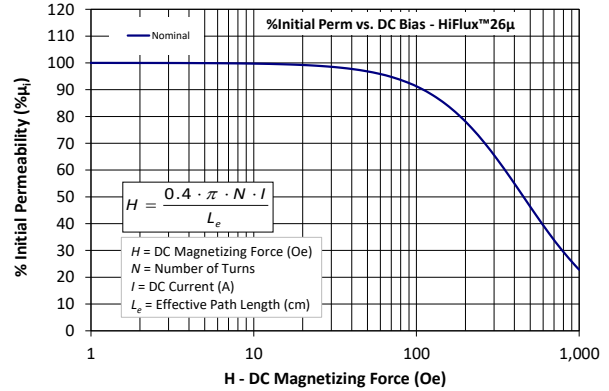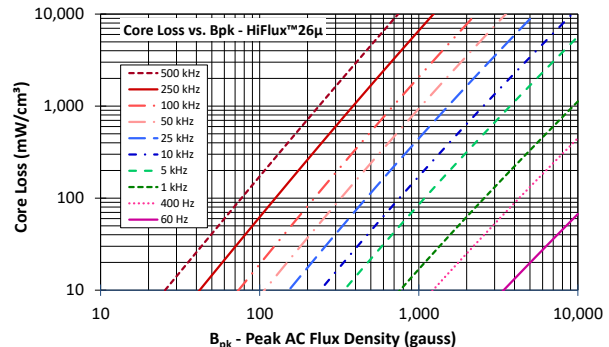

Handling and Storage: Cores should be stored in the original unopened packaging between -10°C and +50°C and less than 60% relative humidity. After the original packaging is opened, the cores should be stored between -8°C and +25°C less than 30% relative humidity. Gloves should be used when handling uncoated cores. The cores should also be sheltered from rain, moisture, salt water, salt air, plasters, ashes, sulfur, sulfur dioxide, ammonia sulfates, soils, acids, metals shavings, and solvents.

Operating Temperature: Cores can be used continuously at operating temperatures between -60°C and +200°C.

RoHS 2.0, REACH and ISO (TS16949, ISO 9001, ISO 14001) compliant. Statements available for download at www.micrometalsapc.com.

Micrometals Alloy Powder Cores, A Division of Micrometals, Inc. - 5615 E. La Palma Ave., Anaheim, California 92807 USA

Ph: +1-714-970-9400, Toll Free in USA: +1-800-356-5977, Asia Pacific Sales: +852 3106 3736

www.Micrometals.com